

INSTALLATION INSTRUCTIONS ROWE 4900 - KIT#8402R

**THIS INSTALLATION USES THE 8000/8900 MODULE
AND ACCEPTS ONE DOLLAR BILLS ONLY**


Turn off power switch and unplug vendor from wall outlet.

Install the 8000/8900 module on the sliding panel
(as pictured at right). The interrupter plug (end of
ribbon cable) will plug in between the coin changer
and the machine socket.

Connect the #8010 power/validator
harness to the bottom of the module. One part of this
harness goes to the bill validator, the other will go to the
incoming power source. Strap harness onto main harness
to avoid damage when opening and closing the door.

Connect #8811-0 Mars adaptor harness to the end of the 8010 harness and plug into bill validator.

The power half of the #8010 will end at the
base of the machine. Cut off the molex
connector and splice as follows:(see right)
Black to hot, White to neutral, Spade clip to ground
!!DO NOT CONNECT TO A LIGHTING CIRCUIT!!

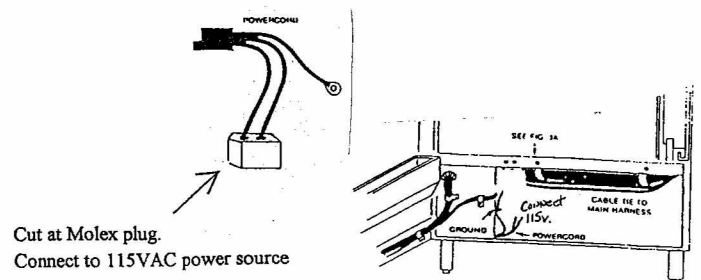

Plug machine into wall and turn on power switch. Bill validator should cycle.
Make sure coin tubes are filled and test vend the unit.

SWITCHES ON 8000/8900 Module:

- 1,2, & 3 - tells validator how many bills to accept.
- 4,5, & 6 - monitors nickel, dime, and quarter tubes for exact change feature.
- 7- inhibits bill validator
- 8- forced vend mode.



2062 E. 70TH STREET, CLEVELAND, OH 44103
(216) 361-1022 OR TOLL FREE (800) 445-8363

